Agilent PNA Microwave Network Analyzers

Application Note 1408-15

Banded Millimeter-Wave Measurements with the PNA





Table of Contents

Introduction	3
System Configuration	4
System Operation Configuring millimeter-wave modules Configuring external synthesizers Operational notes Power control Power control Power leveling Expected output power	9 11 14 14 15 15
Resolution of frequency source Multiple channels	15
System Calibration Choosing the right calibration technique Loading and checking calibration definition file Configuration #1: Two T/R modules Configuration #2: One T/R & one T modules	16 17 20
Application Examples Example #1: Antenna measurements Example #2: Pulsed measurements. Example #3: Materials measurements.	24 25
Appendix A: Creating Your Own Waveguide Calibration Kit Definition	28
Appendix B: Performing Calibrations SmartCal, 2-port SmartCal, 1-port Unguided Calibration, Thru Response	34 37
Appendix C: Caring for Waveguide Interfaces	41
Appendix D: Supplemental Data	42

Introduction

Millimeter-wave is becoming more common as measurement needs are pushed beyond 110 GHz, to 220 GHz, 325 GHz, and even 1 THz! Applications include on-wafer device characterizations as well as various types of materials measurements.

The PNA series network analyzers can be configured for wide dynamic range reflection and transmission measurements of components at millimeter-wave frequencies. Two types of millimeter-wave solutions are available from Agilent Technologies:

- One solution is the N5250C network analyzer. With 1.0mm coaxial test port connectors, this solution provides single, continuous measurement sweeps from 10 MHz to 110 GHz.
- 2. The other solution is based on banded millimeter-wave test head modules with waveguide (WG) interfaces. System configuration differs depending on frequency range of interest.

The objective of this application note is to provide detailed information on the banded millimeter-wave solutions. This includes system configurations, system operation, system calibration, and some typical measurement examples. This note applies to the following product numbers within the PNA and PNA-X series: E8362B, E8363B, E8364B, E8361A, N5242A, N5244A and N5245A.

Banded Millimeter Wave System Configuration

To configure a banded millimeter wave measurement system, three basic components are required:

- 1. A performance network analyzer
- 2. Millimeter wave test set controller
- 3. A waveguide module based on application need and frequency band
- 4. An optional calibration kit in waveguide unless on-wafer or other media is being used

Performance network analyzer

Product model	Description	Minimum required options
E8362C	20 GHz 2-port performance network analyzer	H11, 080, 081, 014 and UNL
E8363C	40 GHz 2-port performance network analyzer	H11, 080, 081, 014 and UNL
E8364C	50 GHz 2-port performance network analyzer	H11, 080, 081, 014 and UNL
E8361C	67 GHz 2-port performance network analyzer	H11, 080, 081, 014 and UNL
N5242/44/45A Opt. 2xx	2-port PNA-X network analyzer	Option 020
N5242/44/45A Opt. 4xx	4-port PNA-X network analyzer	Option 020

Note: When configuring the N5242/44/45A (Option 200 and 224 required) with a N5262A 4-port millimeter wave test set controller, also include Option 551 for 4-port calibration capability.

Optionally for rear panel connection of the RF source to the N5261A/N5262A test set controller include the switch combiner options to the N5242/44/45A selected above. For N5242/44/45A with Option 2xx, add Option 224 and for the N5242/44/45A with Option 4xx, add Option 423.

For E836x based systems used with modules above 200 GHz, these systems require a pair of external synthesizers (one for RF and the other for LO) to increase the dynamic range, see Figure 9 for improvement. Recommended synthesizers are E8257D with Options 520 and UNX.

Millimeter wave test set controllers

Product number	Description	Options
N5260A	2-port test controller for PNA based solution	Includes all cables for connection to PNA as well as two sets of 48 inch RF, LO, DC and IF cables for connection to a pair of T/R millimeter modules.
N5261A	2-port test set controller for PNA-X based configuration	 Option 102 – A set of cables for connection to a 2-port PNA-X Option 104 – A set of cables for connection to a 4-port PNA-X Option 50x – A single set of RF, LO, DC and IF cables for connection to a single T/R millimeter module (see Option Descriptions for details).
N5262A	4-port test set controller for PNA-X based configuration	 Option 102 – A set of cables for connection to a 2-port PNA-X Option 104 – A set of cables for connection to a 4-port PNA-X Option 50x – A single set of RF, LO, DC and IF cables for connection to a single T/R millimeter module (see Option Descriptions for details).

When configuring the PNA-X with a N5260A millimeter wave test set controller, please include a 10 dB 3.5 mm pad for connection to the LO and a set of four BNC to SMA adapters.

Millimeter wave modules

Several modules are available and other special options may be configured on request. Select the appropriate quantity of modules required for the measurement set up. To request a specially configured test module contact your local Agilent sales engineer.

The single and dual channel receiver modules are used for antenna applications or for 1-port single path S-parameter measurements.

Transmission reflection modules

Waveguide flange	Frequency GHz	Standard transmission/ reflection modules	Transmission/ reflection Modules with 25 dB mechanical attenuator	Transmission/ reflection Modules with 15 dB LO and RF amplifier ¹
WR22	33 - 50	N5256AW22 - STD	N5256AW22 - 001	N5256AW22 - 002
WR15	50 - 75	N5256AW15 - STD	N5256AW15 - 001	N5256AW15 - 002
WR12	60 - 90	N5256AW12 - STD	N5256AW12 - 001	N5256AW12 - 002
WR10	75 - 110	N5256AW10 - STD	N5256AW10 - 001	N5256AW10 - 002
WR08	90 - 140	N5256AW08 - STD	N5256AW08 - 001	N5256AW08 - 002
WR06	110 - 170	N5256AW06 - STD	N5256AW06 - 001	N5256AW06 - 002
WR05	140 - 220	N5256AW05 - STD	N5256AW05 - 001	N5256AW05 - 002
WR03	220 - 325	N5256AW03 - STD	N5256AW03 - 001	N5256AW03 - 002
WR02.2	325 - 500	N5256AW02 - STD	Not available	N5256AW02 - 002 ²
Extended WR12	56 - 94	N5256AX12 - STD	N5256AX12 - 001	Available on request

 Note the modules with the RF/LO amplifiers are for antenna applications that include a cable loss of 15 dBm to the module from the port of the Test set being used. Do not connect these directly to the test set controller port with the standard 48 inch cable, use a 15 dB pad if needed.

2. These modules require an external DC power supply (e.g. E3615A) when using them with the N5260A.

 For transmission reflection modules with both the 25 dB mechanical attenuator and the 15 dB LO and RF amplifier order N5256AWxx-003. Not available for N5256AW02

Single channel receive modules

Waveguide flange	Frequency GHz	Standard single channel receive modules	Single channel receive modules with 15 dB LO amplifier
WR22	33 - 50	N5257AR22 - STD	N5257AR22 - 001
WR15	50 - 75	N5257AR15 - STD	N5257AR15 - 001
WR12	60 - 90	N5257AR12 - STD	N5257AR12 - 001
WR10	75 - 110	N5257AR10 - STD	N5257AR10 - 001
WR08	90 - 140	N5257AR08 - STD	N5257AR08 - 001
WR06	110 - 170	N5257AR06 - STD	N5257AR06 - 001
WR05	140 - 220	N5257AR05 - STD	N5257AR05 - 001
WR03	220 - 325	N5257AR03 - STD	N5257AR03 - 001
WR02.2	325 - 500	N5257AR02 - STD	Available on request


Dual channel receive modules

Waveguide flange	Frequency GHz	Standard dual channel receive module	Dual channel receive module with 15 dB LO amplifier
WR15	50 - 75	N5258AD15 - STD	N5258AD15 - 001
WR12	60 - 90	N5258AD12 - STD	N5258AD12 - 001
WR10	75 - 110	N5258AD10 - STD	N5258AD10 - 001
WR08	90 - 140	N5258AD08 - STD	N5258AD08 - 001
WR06	110 - 170	N5258AD06 - STD	N5258AD06 - 001
WR05	140 - 220	N5258AD05 - STD	N5258AD05 - 001
WR03	220 - 325	N5258AD03 - STD	N5258AD03 - 001

Millimeter wave calibration kits

Waveguide flange	Frequency GHz	Calibration kit
WR22	33 - 50	Q11644A
WR15	50 - 75	V11644A
WR12	60 - 90	N5260AC12
WR10	75 - 110	W11644A
WR08	90 - 140	N5260AC08
WR06	110 - 170	N5260AC06
WR05	140 - 220	N5260AC05
WR03	220 - 325	N5260AC03
WR02.2	325 - 500	N5260AC02
Extended WR12	56 - 94	N5260AC12

OML VNA2 waveguide test head modules are available in transmission/reflection (T/R) and transmission (T) configurations. Each Agilent part number, N5260AWxx, includes a pair of T/R test head modules and the respective WG calibration kit. Figures 2 and 3 show the simplified block diagrams of an OML VNA2 T/R test head module and a T test head module, respectively. Other combinations of test head modules may be available from Agilent Technologies; as an example, one T/R and one T modules. Please contact your local Agilent Technologies representative for more detail.

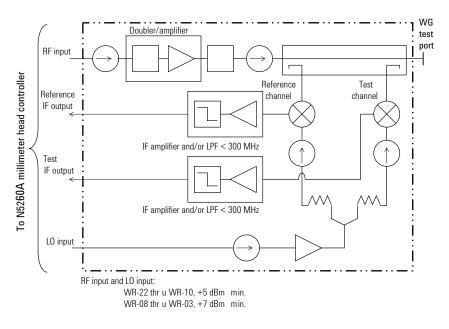



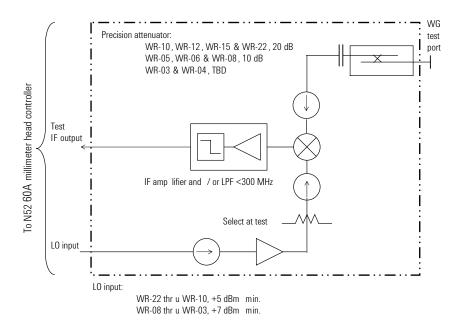


Figure 3. Simplified block diagram of an OML T test head module.

Different combination of test head modules covering the same frequency range can be used together, but will result in different available parameters. Table 3 shows details of the possible combinations. A full "S-parameter" test set requires two T/R modules. One T/R module and one T module will result in a "T/R" test set where only one transmission measurement and one reflection measurement are possible.

Table 3. Combination of test head modules and available measurements.	Table 3.	Combination o	f test head	modules and	available measurements.
---	----------	---------------	-------------	-------------	-------------------------

	Port 1	Port 2	Available Parameters	Comments
Combination #1 (Figure 4a)	T/R module	T/R module	S11, S21, S12, S22	Both ports 1 and 2 can supply stimulus to DUT
Combination #2 (Figure 4b)	T/R module	T module	S11, S21	Only port 1 can supply stimulus to DUT

If S12 and S22 are needed for combination #2, two approaches are possible:

- 1. Reverse the DUT to measure the reverse parameters.
- Reconfigure the test head modules by placing the T/R module on port 2 and the T module on port 1. This approach requires a calibration before measurements can be made.








Figure 4. Two combinations of test head modules: (a) Two T/R modules, and (b) one T/R module (left) and one T module.

System Operation

This section describes how to operate the banded millimeter-wave system. System operation includes creating a configuration for each set of millimeter-wave modules, calibrating the system, and taking measurements.

Figures 5 and 6 illustrate the front and rear panel connections of the system. Rear panel connections are slightly different if external synthesizers are used (Figure 6b). For details on system installation, please refer to the N5250A Network Analyzer Systems Installation Guide, part number N5250-90001.

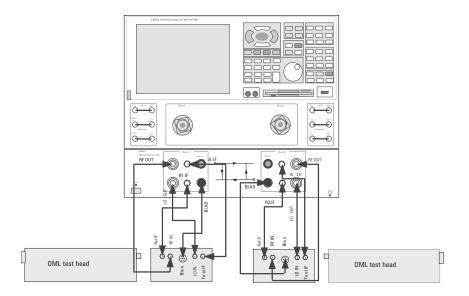


Figure 5. Front panel connections of the N5260A millimeter-wave controller to the waveguide test head modules.

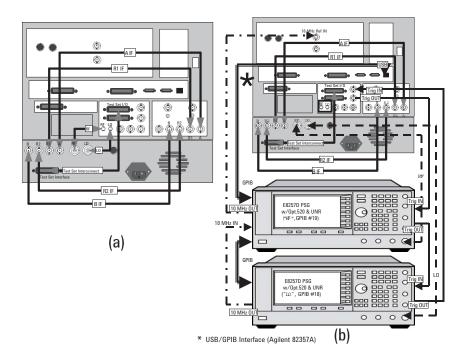


Figure 6. Rear panel connections: (a) without external synthesizers, and (b) with two PSGs as external synthesizers. Connection between the PNA and a PSG must be done via USB/GPIB Interface (Agilent 82357A), and PNA *Trig OUT* must go to *Trig IN* of RF synthesizer.

System setup procedure has been greatly simplified due to extensive enhancements made to the PNA firmware. The following steps show how to create a configuration for each set of millimeter-wave modules. For multiple frequency bands, one configuration is needed for each band.

Configuring millimeter-wave modules:

Before proceeding to the front panel of the PNA, please make sure the rear panel connection of the system is completed as illustrated in Figure 6a, and the N5260A millimeter-wave controller has been turned on.

- System > Configure > Millimeter Module Config..., this brings up display (a) as shown in Figure 7.
- 2. Click on *Module Config*, this brings up display (b).
- Click on *New*, this brings up display (c), and enter the name of configuration. It is best for the name to be descriptive and representative of the frequency band. (The example shows "60 to 90 GHz".)
- 4. Click OK. This brings up display (d). Enter values of the frequency range and the values of the multipliers, both RF and LO. Multiplier values can be obtained either from the labels on the test head modules, or from Table 4 below. Click Save when done.

Band	Frequency range of operation (GHz)	RF frequency range (GHz)	RF harmonic multiplier	LO frequency range ± IF offset (GHz)	LO harmonic multiplier
WR-15	50 - 75	12.5 to 18.8	N = 4	10.0 to 15.0	M = 5
WR-12	60 - 90	10.0 to 15.0	N = 6	12.0 to 18.0	M = 5
WR-10	75 – 110	12.5 to 18.4	N = 6	9.3 to 13.8	M = 8
WR-08	90 - 140	7.5 to 11.7	N = 12	11.2 to 17.5	M = 8
WR-06	110 — 170	9.1 to 14.2	N = 12	11.0 to 17.0	M = 10
WR-05	140 - 220	11.6 to 18.4	N = 12	14.7 to 18.1	M = 12
WR-04	170 - 260	8.5 to 13.0	N = 20	12.1 to 18.6	M = 14
WR-03	220 - 325	12.2 to 18.1	N = 18	12.2 to 18.1	M = 18

5. To apply a configuration, highlight the configuration, and then click on Activate Selected Config. This brings up display (e), click OK and the PNA will exit and restart with the new configuration, as shown in Figure 8. This step may take a minute.

Millimeter Module Cor	diguration						×
Available Configuration	(s):	Select	nd Configuration:	Config0	<u>.</u>		
Standard PNA	1	Test S	et Properties				
Cosfig()	1		nd Test Set:		1	N5262A -	
Config1							
		F Ba	ie PNART to reary	panel "SWI			
		E Ena	ble Test Set RF AL	c	P Usel	full Bandwidth	
		Mary De	ower Limit: 11.00		A: M	utiplier RF IN	
			mer chine Lasse				
		RFCa	hle Lass (DO NOT	include tes	t set gain)		
New	Remove	Power	Offset: 0.00 dB	8	Power Slo	pec 0.113 alb/Gh2	8
Frequency Settings							
a server of a serv	Start Frequence	0	Stop Frequency		Multiplier	Source	
Multiplier RF IN:	11.100000007		18.333333333333		In In	[marked and a second s	-
wrenthess sec. sec.	11.1000000007	Griz	18.333333333333	aru -	6 5	PNA RF Source	-
Multiplier LO IN:	8.3750000000 0	14	13.7500000000 0	SHz	8 🗄	PNALO Source	
Test Poet Frequency:	67.000000000	011	110.000000000	0.11		THE CO GALLER	-
concentration and an inclusion of a	67.000000000	Gre	111000000000	GLO			
Clicking OK will preset				ж	Can	cet He	1
Cacking Or. was preser				<i>m</i>	Can	CEL FIE	φ

Step One: Select System Configure Millimeter Wave configuration to initiate setup.

Standard PNA	
Config0	
Config1	

Step Two: Provide a Name for the Configuration

Test Set Properties	
Selected Test Set:	N5262A 💌
Route PNA RF to rear panel "S	W SRC OUT"
Enable Test Set RF ALC	Use Full Bandwidth
Max Power Limit: 11.00 dBm	At Multiplier RF IN
RF Cable Loss (DO NOT include	test set gain)
Power Offset: 0.00 dB	Power Slope: 0.113 dB/Ghz

Step Three: Test Set Configuration Select **Test Set Controller** being used.

Uncheck *RF ALC* only if you need to make *Pulse* measurements.

Check "Use Full Bandwidth" only for mixer measurements.

Leave all other settings to default.

	Start Frequency	Stop Frequency	Multiplier	Source
Multiplier RF IN:	11.1666666667 GHz	18.3333333333 GHz	6 ÷	PNA RF Source
Multiplier LO IN:	8.3750000000 GHz	13.7500000000 GHz	8 ÷	PNA LO Source
Test Port Frequency:	67.00000000 GHz +	110.00000000 GF		

Step Four: Frequency Settings

Set the *RF* multiplier factor for the frequency extenders.

Set the LO multiplier factor for the frequency extenders.

Set the Start and Stop Frequency for the frequency extender.

Select **PNA RF** or **PNA LO** source if external sources are being used.

Figure 7. Steps necessary to create a millimeter-wave module configuration. The example shows a frequency band of 67 to 110 GHz.

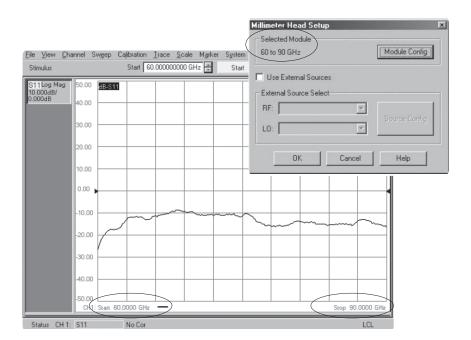


Figure 8. PNA operating in newly created millimeter-wave band configuration.

Configuring external synthesizers:

External synthesizers can be added to any banded millimeter-wave configuration at anytime. Before proceeding to the PNA front panel,


- make sure the rear panel connection of the system is completed as illustrated in Figure 6b
- turn on the N5260A millimeter-wave controller
- turn on both external synthesizers and set the GPIB address of each unit via its front panel as illustrated in Figure 6b:

Utility > GPIB/RS-232 LAN > GPIB address

Enter **19** (for the RF unit) and **18** (for the LO unit) Press softkey *Enter*

Proceed to the PNA front panel to configure the external synthesizers.

- 1. System > Configure > External Source Config..., this brings up display (a) as shown in Figure 9.
- 2. Click on *Add*, this brings up display (b). Enter "Source Name" and then use the drop-down menu to select the "Source Type" of "AGPSG" (only Agilent PSG Series are supported, please see **Operational Notes** for details). Click *OK*. (The example shows the "Source Name" as "PSG RF 19" to indicate that the synthesizer to be used is the PSG series, the unit is intended for the RF signal, and the GPIB address is 19.)
- This brings up display (c). With the source name "PSG RF 19" highlighted, click on Hardware List (BNC) and then update the "GPIB Address" to make sure it is in agreement with the setup (the address is 19).
- 4. Click on *Add* (this time to add the LO source). This brings up display (d). Enter "Source Name" and then use the drop-down menu to select the "Source Type" of "AGPSG." Click *OK*. (The example shows the "Source Name" as "PSG LO 18" to indicate that the synthesizer to be used is the PSG series, the unit is intended for the LO signal, and the GPIB address is 18.)
- 5. This brings up display (e). With the source name "PSG LO 18" highlighted. Click on *Hardware List (BNC)* and then update the "GPIB Address" to make sure it is in agreement with the setup (this time, the address is 18). Click *OK*. You have now completed configuring the external synthesizers.

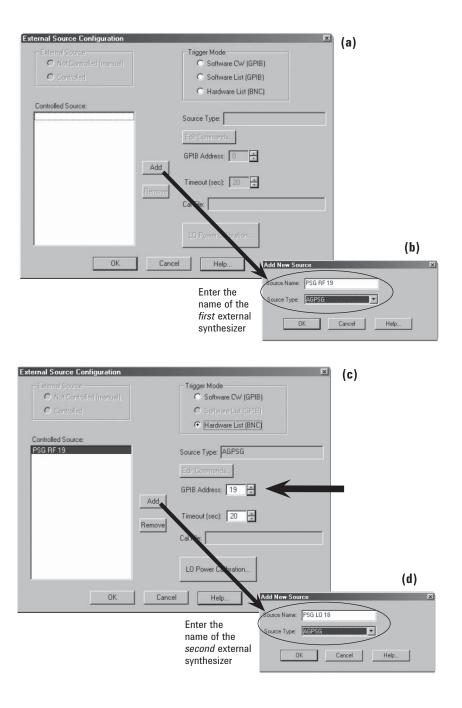

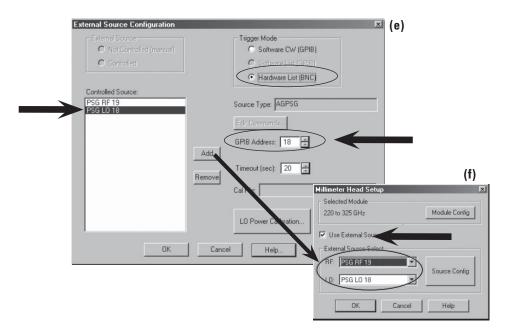


Figure 9. Steps necessary to configure and apply external synthesizers.

Now apply the external synthesizers to the active configuration:

- 6. System > Configure > Millimeter Module Config..., this brings up display (f) of Figure 9. (This example shows the "Selected Module" as "220 to 325 GHz".)
- 7. Click on Use External Sources, and then use the drop-down menu to select the "RF" and "LO" under "External Source Select." Click OK when done. (As you can see, all sources you have configured will appear under each drop-down menu. This is why it is important to make the "Source Name" descriptive. Otherwise, it maybe difficult to figure out each one.)

Operational Notes

Power control

Power control is not available when operating at banded millimeter-wave frequencies. Although one appears to be able to vary power under **Channel > Power... > Test Port Power**, in reality, it makes no difference at the waveguide interface because (1) the amplifiers inside the test head modules are designed to operate at saturation (see Figure 2), therefore, increasing the RF Test Port Power in the PNA results in no change at the waveguide interface; (2) the RF and LO outputs from the rear panel of the PNA are coupled off before the splitter or any control mechanism, thus, providing no control for power.

Without external synthesizers, the RF and LO signals are provided by the PNA's rear panel (Option H11). These values vary over a wide range; the typical values are shown in Table 5.


Table 5. Typical values of the RF and LO outputs from the rear panel of the PNA.
--

Rear Panel LO power (typical)			
1.7 GHz to 20 GHz -16 to -7 dBm			
Rear panel RF power for E8362B (typical)			
1.7 GHz to 20 GHz -16 to -5 dBm (at -5 dBm test port power ¹)			
Rear panel RF power for E8363B/E8364B (typical)			
1.7 GHz to 10 GHz	-12 to -2 dBm (at -5 dBm test port power ¹)		
10 GHz to 16 GHz	-8 to 0 dBm (at -5 dBm test port power ¹)		
16 GHz to 20 GHz	-1 to +5 dBm (at -5 dBm test port power ¹)		

With external synthesizers, the PSG sources are remotely controlled by the PNA. The PNA downloads the frequency list to each PSG (E8257D with Option 520) and the output is set to 0 dBm for each frequency point.

How do we know if the heads are driven with sufficient power?

The ALC loops inside the N5260A millimeter-wave controller are in place to guarantee sufficient RF power is available at the test heads to drive them (see Figure 10).

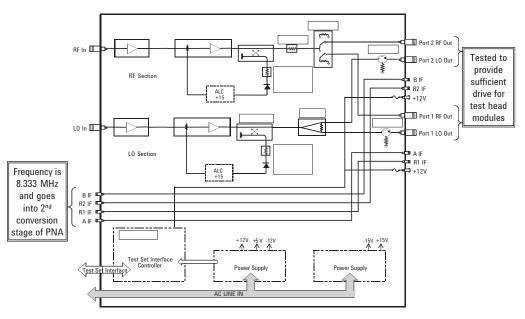

_____ Figure 10. Simplified block diagram of N5260A millimeter-wave controller.

 Test port power has to be at a high enough level such that the "Drop Cal" does not occur. If Drop Cal occurs, then the power out of the rear panel RF connector will drop by about 15 dB.

Power leveling

Power leveling is not available when operating at banded millimeter-wave frequencies. (Please see *Power control* in this document for more information.)

Expected output power

For each test head module shipped, OML ships along a plot of its output power vs. frequency at the waveguide interface. These values vary depending on the frequency band of interest.

IF BW selection

For optimal performance at millimeter-wave frequencies, it is recommended that the IF BW be no wider than 1 kHz, preferably 10 Hz. Otherwise, traces can be noisy.

Resolution of frequency source

Only Agilent PSG sources are supported. Because frequency up-conversions done in the test heads require high harmonic multipliers (higher multipliers for higher frequency bands, see Table 4 for details), it is necessary for external synthesizers to have precision to sub-Hz resolution level. If 1-Hz resolution sources are used, errors can propagate resulting in sizable frequency errors.

Frequency resolution of the PSG Series (CW) is 0.001 Hz. PNA 1st IF = 8.333333... MHz IF = N*rf +/- M*L0

Example:

RF = 110 GHz (measurement frequency of WR-10) N = 6 (from Table 4) rf = RF / N = 110 GHz / 6 rf = 18.33333333... GHz (frequency of external RF source) M*L0 = IF + N*rf M*L0 = 8.333333... MHz + 110 GHz = 110008333333.333... Hz M = 8 (from Table 4) L0 = 110008333333 Hz / 8 L0 = 13751041666.625 Hz (frequency of external LO source)

As you can see, due to the unique value of the PNA 1st IF, the values needed for the external RF and LO synthesizers are most likely never to be whole numbers. Therefore, it is necessary for external synthesizers to have sub-Hz resolution in order to yield an accurate PNA 1st IF.

Multiple channels

Using multiple channels is not supported when operating in external synthesizer configuration. This is primarily because when switching from one channel to the next, the PNA has to download all the necessary information to the PSGs before starting a sweep. Timing differences between channel switching (within the PNA) and signals within the trigger chain (outside the PNA) could result in erroneous data collection for the trace being swept.

System Calibration (error-correction)

Choosing the right calibration technique

Applicable calibration techniques depend on the system (hardware) configuration. Table 6 shows the available calibration techniques for two possible system configurations: one with two T/R modules, and the second with one T/R module and one T module. Depending on the technique chosen, the calibration interface on the PNA may be different.

Table 6. Combination of test head modules and applicable calibration techniques.

	System configurations				Calibration interface	
	Configuration #11		Configuration #2 ²			
	· ·	wo T/R modules parameter test set)	(transmissio	and one T module n/reflection est set)	SmartCal (guided calibration)	Unguided calibration
OPEN Response	\checkmark	S11 OR S22		S11		\checkmark
SHORT Response	\checkmark	S11 OR S22		S11		√
THRU Response	\checkmark	S21 OR S12	\checkmark	S21		√
1-Port Reflection	\checkmark	S11 OR S22		\$11	\checkmark	\checkmark
Full SOLT 2-Port	\checkmark	S11, S21, S12, S22		•	\checkmark	\checkmark
Full TRL 2-Port	\checkmark	S11, S21, S12, S22			\checkmark	\checkmark

1. See Figure 4a

2. See Figure 4b.

Each N5260AWxx includes a pair of T/R test head modules (configuration #1) and the respective WG calibration kit. With this, the setup would allow for measurements of S11, S21, S12 and S22. Plus, full 2-port calibration is possible with SOLT, and TRL.

Note

Setting System Z_0 to $1-\Omega$: When performing Unguided calibration with waveguide interface, the user must manually set the System Z_0 to $1-\Omega$ to match the waveguide kit. This is because Unguided calibration uses System Z_0 during calibration computation. Whereas, SmartCal uses the Z_0 defined by the connector definition and is applied automatically during calibration.

System > Configure > System ZO

Enter a value of 1 for waveguide, then click *OK*.

With configuration #2, although the setup only allows for measurements of S11 and S21, the user can perform either 1-port calibration for S11, or thru response calibration (normalization) for S21, or *append* the latter calibration to the previous thus creating one calset for both traces within one measurement channel¹. Here are the steps to append

- With trace S11 active, perform 1-port calibration using SmartCal, then click Save As User CalSet to finish
- With trace S21 active (in the same channel), while the 1-port calibration is selected, perform response calibration (or normalization) using Unguided Cal, then click *Save As User CalSet* to finish but make sure the selected calset is the same one as the currently active 1-port cal click *Save* to complete
- As the final step, the Calibration Wizard will then ask if appending this calibration to the existing one is desired, as shown in Figure 11, simply click *OK* to confirm. Once finished, the same calset will cover both calibrations, 1-port for S11 and thru response for S21. This way, when you click on S11, the status bar (located on the bottom of the display) shows C 1-Port, and when you click on S21, it shows C Response.

Confirm appe	nd calset.		×	1
You have cho Confirm?	osen to append thi	is calibration to	o calset: CalSet_1.	
	OK I	Cancel]	

Figure 11. Appending a calibration to an existing CalSet.

Each WG calibration kit from OML comes with the following standards and a floppy disk loaded with the calibration definition file formatted for the PNA:

- · Precision Terminations, Fixed Loads, qty 2
- · Precision (flush) Shorts, qty 2
- Precision Insert A (line1), Null Shim
- Precision Insert B (line2), 1/4 Offset Shim
- Adjustable Load

two calibrations:

Precision Section

Loading and checking calibration definition file

Each PNA is shipped with calibration definition files from Agilent calibration kits. For non-Agilent calibration kits such as the WG calibration kits from OML, the user must first load the file and then check to make sure all the items are in order. (The user can also choose to create his own WG cal kit file if desired. Refer to Appendix A for details.)

Calibration > Advanced Modify Cal Kit ... > Import Kit ...

Use dropdown menu to select "3½ Floppy (A:)" Highlight the file to be imported, and click **Open**

Once the file is loaded, it will appear on the list of *Installed Kits* as shown in Figure 12. Highlight the file of interest, (The example shows *V05_OML*.) and click Edit Kit ... in order to view the kit definition. On this page, you can see all the standards (and combinations) as defined for this particular WG calibration kit.

Edit PNA Cal Kits Open Save At Restore Defaults Installed Kas	Edit Kit XI Identification Kit Number 37 Kit Name X05/01XI Kit Description OML WR-05 (G Band) Universal Calibration Kit Connectors Description: WR-05 Waveguide Add or Edit Family WR-05 Waveguide Change Family
Import Kit. Save As Insert Ner Print to File. 10 Kit Name Description 1 950328 /c TypeN 1601 Caltration K 21 850540 TypeN 1601 Caltration K 1 4 850540 TypeN 1601 Caltration K 23 850540 TypeN 1601 Caltration K 2 850547 TypeN 1601 Caltration K 2 24 850308 /c TypeN 1751 Caltrating K K 2 2 850398 TypeP 1751 Caltrating K K 25 850398 /c TypeP 1751 Caltrating K K 2 2 2 4 26 Example K A Example Calt K y moneed and female ormectors 2 2 2 111 Caltration K A 27 Example K A X tom V weey de SOLT TYPL Caltration K 2 2 2 112 Caltration K A	ID Standard Description 1 Shoth GB and Fluck Sty (15:05) 2 Shoth-Null Shim GB and Fluck Sty (15:05) 3 Shoth-Null Shim GB and Fluck Sty (15:05) 4 Shoth-Null Shim GB and Fluck Sty (15:05) 5 Load GB and Fluck Sty (15:05) 6 Load Al Motted Stim GB and Fluck Sty (15:05) 9 Load Stole Stand Fluck Sty (15:05) Shoth-Null Shim 9 Load Stole Stand Fluck Sty (15:05) Shoth-Null Shim 10 Load Stole Add Description Shoth-Null Shim 110 Load Stole Add Description Shoth Sty (15:05) 12 Load Stole Add Description Prediction 13 Thru Connector Family WFL60 Weregade 14 Thru-Null Shim Gender Male 15 Thru-Null Description WR dS Weregade 16 Thru-Null Frequency Range Male 16 Thru-Null Shim Thru-Null 16 Thru-Null Shim Shift Shif

Figure 12. Loading the calibration definition file and checking on the connector definition.

The examples in Figure 14 show the standards and class assignments for both TRL and SOLT. These are defined as shown in Table 7. Figure 15 shows examples of the details of each standard definition.

		•	
-	Class Assignments	Class Label	Selected Standards
TRL	TRL THRU	THRU	Thru + Null Shim
	TRL REFLECT	REFLECT	Flush Short
	TRL LINE/MATCH	LINE	Thru + 1/4 Offset Shim
SOLT	S11A, S22A	OPENS	Short + Null Shim
	S11B, S22B	SHORTS	Short + 1/4 Offset Shim
	S11C, S22C	LOADS	Flush Fixed Load
	FWD TRANS	THRU	Thru

Table 7. Standards and class assignments of TRL and SOLT calibrations.

Thru-reflect-line (TRL) calibration:

Setting test port reference plane

Two selections are available for setting the test port reference plane; *Thru Standard* or *Reflect Standard* (see Figure 13). If a flush short is used for the reflect standard, then select the "Reflect Standard" for the "Test port Reference Plane". A flush short provides a much more accurate phase reference than a thru standard.

Short-open-load-thru (SOLT) calibration:

Adjustable load

Although an adjustable load is shipped in each WG calibration kit from OML, this standard is not ideal for millimeter-wave frequencies because mechanical tolerances make obtaining repeatable results difficult. Plus, adjustable loads are best if step sizes can be varied from large to small as one tries to trace out circles on a smith chart. Given the frequency ranges of these calibration kits, it would be very challenging to produce repeatable results. Therefore, fixed loads are used for the load standards for SOLT.

Offset load

Offset load is available in the PNA with firmware 6.0. Using offset load can result in a more accurate calibration than with broadband load, but it does require extra connections. A typical offset load requires two known offsets along with a load element. As such, one connection is made using the *first offset with the load*, and the other one is made using the *second offset with the load*. Figure 13 shows a definition of an offset load.

Loads	×			
Identification				
Standard ID 3 Label C	Offset Load			
Load Description WR-03 Waveguide	load			
Frequency Range	Connector			
Min 173580 MHz	WR-03 Waveguide			
Max 347159 MHz				
Load Type Arbitrary O Fixed Load O Impedance	Complex Impedance Fieal 50			
C Sliding Load O Offset Load	imag 0			
Delay	Loss 0 Gohms/s			
Z0 1 ohms				
Offset Load Definition First Offset Standard Thru+Null Shim				
Second Offset-Standard Thru+1/4 Offset Shim				
Load Standard Load				
Clear OK (Cancel Apply Help			

Figure 13. Example of an offset load definition.

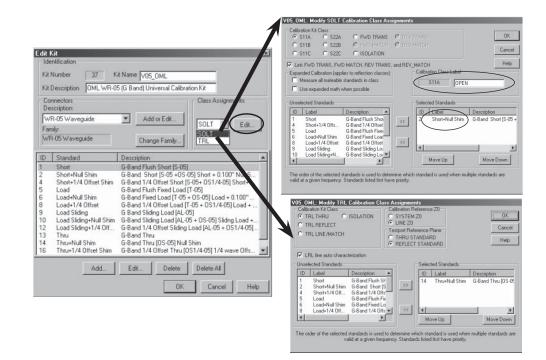


Figure 14. Examples of TRL and SOLT class assignments.

	Shorts
dit Kit	Identification 1 Label Stard Standard ID 1 Label Stard Short Description G-Band Flush Short [S-05] Stard
Kit Number 37 Kit Name 30530001 Kit Description 00L WR-05 (G Band) Universal Calibution Kit Connectors Class Assignments	Frequency Range Connector Min 115696 MHz WR-05 Waveguide Max 231392
Description WR-05 Waveguide SOLT Edk Family WR-05 Waveguide Change Family	Short Characteristics L2 0 H(e-33)/Hz ² L0 0 H(e-12) L2 0 H(e-33)/Hz ² L1 0 H(e-24)/Hz L3 0 H(e-42)/Hz ²
ID Standard Description 1 Shoot G-Band Fluck Shot (5:05)	Delay Characteristics Delay 0 D5ms Loss 0 Gohms/s 20 1 o/m Loss 0 Gohms/s Shorts Standard ID z Let Short-NULIShim Short Description G Band Short (5:05:405) Short + 0.100" Null Sh
16 Thru+1/4 Offset Shim G-Band 1/4 Offset Thru [0S1/4-05] 1/4 wave Offs Add Edit Delete Delete All OK Cancel Help	Frequency Range Connector Min 115636 MHz Max 231332 MHz Short Characteristics L0 H(e+12) L1 0 H(e-24)/Hz L3
	Delay Characteristics pSec Loss 0 Gohms/s 20 1 ohms 0 Gohms/s 0
	Clear OK Cancel Apply Help

Figure 15. Examples of standards definitions. Key parameters to check included Min and Max of Frequency Range, as well as Delay and $Z_{\rm e}$.

Configuration #1: Two T/R Modules (S-parameter test set)

With a full 2-port calibration, this configuration allows one to measure all four S-parameters (S11, S21, S12, S22). Full 2-port calibrations are available in either TRL or SOLT. These calibrations are available under *SmartCal* (guided) or *Unguided* calibrations on the PNA under *Calibration Wizard*.

Example #1:WR-12, 60 to 90 GHzEquipment:E8364B with Options 014, UNL, 080, 081, H11
N5260A test set controller
WR-12 (60 to 90 GHz) T/R test heads modulesSetup:IF BW: 100 Hz
Number of Points: 201Calibration:Channel 1: SmartCal, 2-port, Flush Thru, TRL

For 2-port calibrations in waveguide, SmartCal defaults to TRL with Flush Thru. Figure 16

shows that the system dynamic range is better than 90 dB and trace noise is better than ± 0.10 dB.

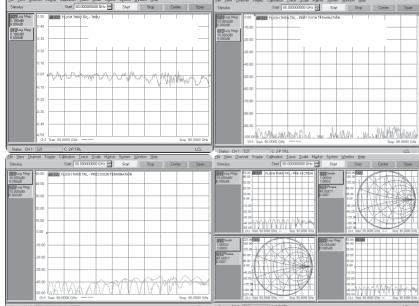


Figure 16. WR-12, 60 to 90 GHz, Flush Thru TRL calibration results.

Note

TRL calibration

TRL only requires four steps. It requires one reflect standard for each test port, one thru and one line (a section with a defined length).

- The reference must be established by the SHORT (reflect) standard.
- The impedance selected must be LINE Z₀.

These are the default settings when using *SmartCal*. When using *Unguided* calibration, the user must check to confirm these settings, as well as setting system Z_0 to $1-\Omega$ (**System > Configure > System Z**₀).

SOLT calibration

SOLT requires seven steps, three more steps than TRL! It requires three standards for each test port, and one thru.

Unknown Thru is available, but only with SOLT. Since SOLT takes more steps and is less accurate than TRL, the only time you should consider performing SOLT calibration is to

benefit from an Unknown Thru. One such situation may be where the test heads are restricted from movement (such as bolted down to avoid cable movements); in such a case, an Unknown Thru would be very useful as it would eliminate the need to move them. Another example is when the test port cables are at 90 degrees, preventing a straight thru from being connected.

When SOLT is needed, using offset load (instead of fixed load) will result in a more accurate calibration. This may require you to modify a cal kit definition as well as performing more connections during the actual calibration.

Configuration #2: One T/R module and one T module (T/R test set)

This configuration allows you to measure only two S-parameters (S11 and S21). For simultaneous corrected measurements of both parameters, one can perform a 1-port calibration for trace S11 and then append the thru response calibration (or normalization) performed for trace S21; thus, resulting in one calset for both traces.

1-port calibrations are available under SmartCal (guided) or unguided calibrations, while Thru Response calibrations (or normalization) are only available under unguided calibrations (see Table 6).

Example #2:	WR-05, 140 to 220 GHz
Equipment:	E8364B with Options 014, UNL, 080, 081, H11
	N5260A test set controller
	WR-05 (140 to 220 GHz) T/R and T test head modules
	E8257D with Options 520 and UNR (Oty of 2)
Setup:	IF BW: 10 Hz
	Number of Points: 201

For the frequency range of 140 to 220 GHz, Figure 17 compares dynamic range and Figure 18 compares trace noise (for S21). In both cases, using Agilent PSG Series as external synthesizers to improve performance. For dynamic range, the improvement was up to 10 dB on average; for trace noise, it went from less than 0.05 dB around 220 GHz to practically non-existence!

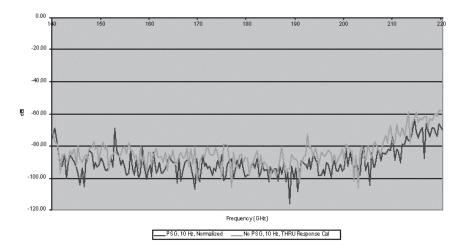


Figure 17. WR-05, 140 to 220 GHz, T/R and T modules. Dynamic range comparison between measurements made with external synthesizers and without.

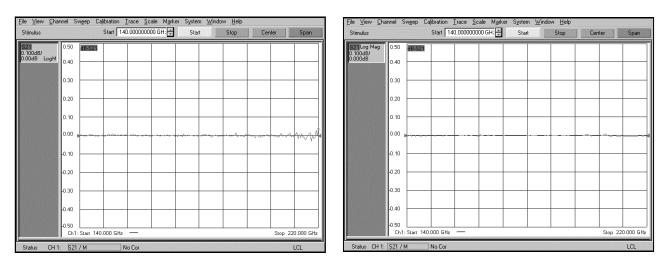


Figure 18. WR-05, 140 to 220 GHz, trace noise comparison between measurements made with external synthesizers (right) and without (left). Both plots have the same scale, 0.10 dB per division.

Example #3:	WR-03, 220 to 325 GHz
Equipment:	E8364B with Options 014, UNL, 080, 081, H11
	N5260A test set controller
	WR-03 (220 to 325 GHz) T/R and T test head modules
	E8257D with Options 520 and UNR (Oty of 2)
Setup:	IF BW: 10 Hz
	Number of Points: 201

For the frequency range of 220 to 325 GHz, Figure 19 compares dynamic range and Figure 20 compares trace noise (for S21). Similar to the previous example (WR-05), using Agilent PSG Series as external synthesizers do improve performance in both cases. However, the improvement for this higher frequency range is much more significant. For dynamic range, the improvement was up to 20 dB on average; for trace noise, it went from less than 0.20 dB around 300 GHz to less than 0.02 dB – that's an improvement of at least ten times!

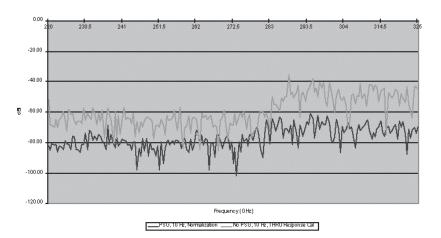


Figure 19. WR-03, 220 to 325 GHz, T/R and T modules. Dynamic range comparison between measurements made with external synthesizers and without.

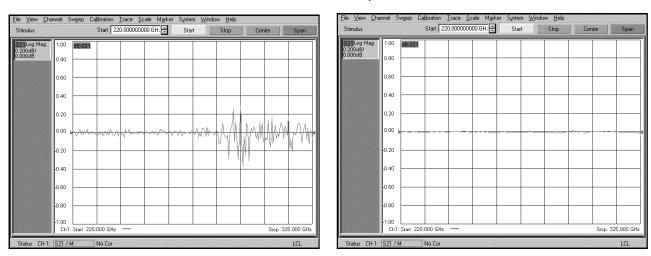


Figure 20. WR-03, 220 to

325 GHz, trace noise comparison between measurements made with external synthesizers (right) and without (left). Both plots have the same scale, 0.20 dB per division.

Application Examples

Example #1: Antenna measurements

Below are two examples of antenna configurations. For more details, please refer to the *Agilent Antenna Test – Selection Guide*, literature number 5968-6759E or visit our web site at **www.agilent.com/find/antenna**

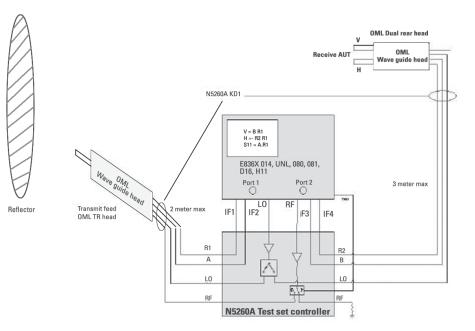


Figure 21. PNA banded millimeter-wave solution applied to *indoor* antenna measurements. The transmit side (left) uses an OML T/R module, and the receive side (right) uses the OML Dual T module. Dual T modules are ideal for measuring both vertical and horizontal polarities of the antenna.

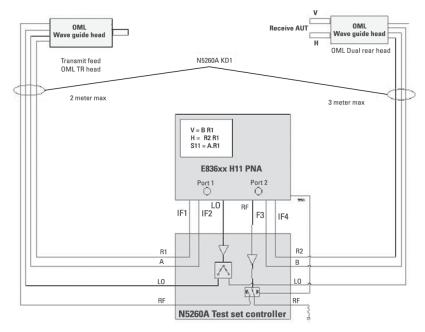


Figure 22. PNA banded millimeter-wave solution applied to *outdoor* antenna measurements. The transmit side (left) uses an OML T/R module, and the receive side (right) uses the OML Dual T module. Dual T modules are ideal for measuring both vertical and horizontal polarities of the antenna.

Example #2: Pulsed measurements

In a banded millimeter-wave configuration, the pulse modulator can be applied to the RF signal coming from either the front of the N5260A millimeter-wave controller or the rear of the PNA. In either case, a dual output pulse generator (Agilent 81110A) will be needed to provide a pulse drive to the modulator as well as the B gate of the PNA. Measurements of point-in-pulse and pulse profiling have been performed for V-band (50 to 75 GHz) and W-band (75 to 110 GHz).

Figure 23 shows the pulse modulator (Agilent Z5623AH81) being placed between the front of the N5260A millimeter-wave controller and the test head module. Since this pulse modulator is unidirectional, this is connected to the port 1 path only. In this configuration, the modulator takes the CW signal coming out of the front of the N5260A and provides a pulsed-RF signal going into the test head module of port 1 and it will in turn deliver a pulsed-RF stimulus to the device-under-test (DUT).

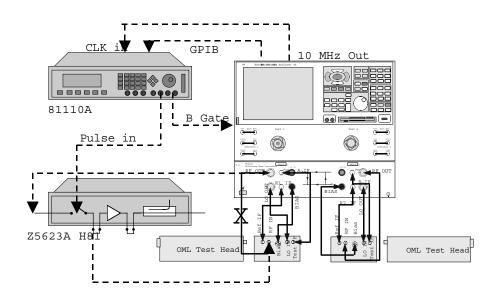


Figure 23. Pulsed the RF signal coming from the front of the N5260A millimeter-wave controller.

Figure 24 shows the pulse modulator being placed between the PNA and the N5260A millimeter-wave controller. In this configuration, the modulator takes the CW signal coming out of the rear panel of the PNA and provides a pulsed-RF signal going into the N5260A millimeter-wave controller. Although the pulse modulator is unidirectional, this configuration will provide a pulsed-RF signal to both ports 1 and 2 because any input into the millimeter-wave controller will be delivered to both ports 1 and 2 due to the presence of the switch inside the controller. Figure 25 compares measurement results of pulse profiling at 100 GHz, and there is no difference whether the signal is pulsed in the front or the rear.

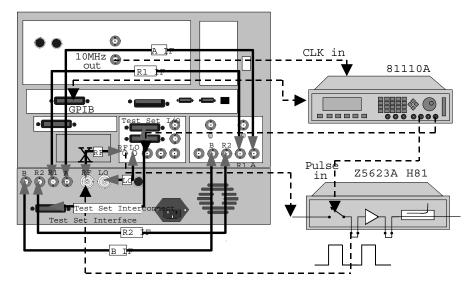


Figure 24. Pulsed the RF signal coming from the rear of the PNA.

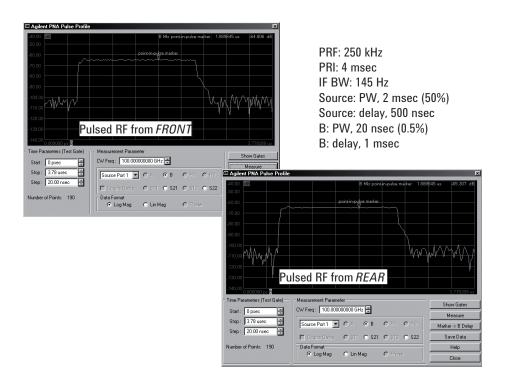


Figure 25. Results of pulse profiling measurements at 100 GHz by pulsing the RF signal from the front of the N5260A as well as from the rear of the PNA.

Example #3: Materials measurements

Figure 26 shows one example configuration of materials measurement in W-band, 75 to 110 GHz. This application requires two W-band waveguide horns and alignment of the test heads in order to transmit and receive test signals. In addition, using the measurement software shown requires two T/R test heads (an S-parameter setup). For more details, please visit our web site at **www.agilent.com/find/materials**

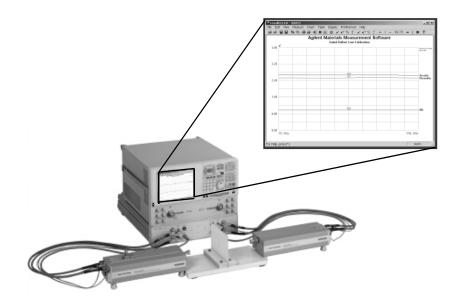


Figure 26. Using materials measurement software and Free Space Calibration technique to perform materials measurements in millimeter-wave. Insert shows measurement software interface.

Appendix A: Creating Your Own Waveguide (WG) Calibration Kit Definition

- 1. Calibration > Advanced Modify Cal Kit > Insert New
- 2. Enter "Kit Name" and "Kit Description" and then click on "Add or Edit" to enter connector information (Figure 27)

Edit Kit X Identification Kit Number Z Kit Name My Dwn WG Kit Kit Description Creating my own WG kit	Enter "Kit Name" and "Kit Description." ("Kit Name" will appear on the list of "installed kits" next time you click
Connectors Description: Add or Edit. Family: Family Change Family	on "Advanced Modify Cal Kit".)
ID Standard Description	
Add Edit Delete Delete All	Click on "Add or Edit" to enter connec- tor information
OK Cancel Help	

Figure 27. Enter calibration kit name.

3. Enter "Connector Family," "Frequency Range" (Min. frequency = Cutoff frequency), 1 for "Z0;" select "No Gender," and "WAVEGUIDE" (Figure 28)

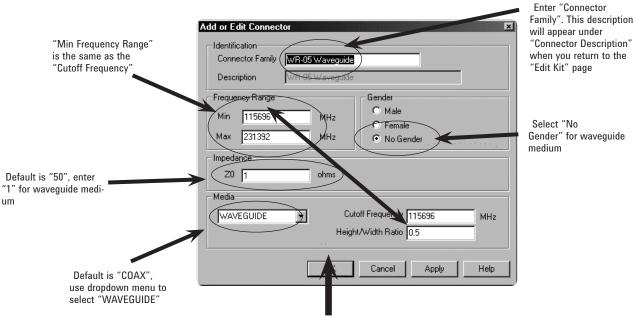


Figure 28. Enter connector (WG) description.

4. Click **OK**. This returns to the "Edit Kit" page (name of the page is shown on the upper-left corner of the dialog box). Click "Add" to start adding standards (Figure 29).

	Edit Kit ×
	Kit Number 3 Kit Name My Own WG Kit Kit Description Creating my own WG cal kit
Clicking OK (on the "Add or Edit Connector" page)	Connectors Class Assignments Class Assignments WG X-band Add or Edit SOLT Edit
returns to the "Edit Kit" page and the connector information appears.	Family: WS X-band Change Family
	ID Standard Description
Click "Add" to	Add Edit Delete Delete All
start adding stand-	OK Cancel Help

Figure 29. Completed connector description, and start adding standards.


5. For waveguide, the best calibration technique may be thru-reflect-line (TRL). There is almost no reason to use SOLT since TRL is more accurate and SOLT requires more steps. Thus, for TRL or its variation such as line-reflect-line (LRL), you may want to add the following standards:

TRL	THRU	Thru (0 delay)
	REFLECT	Flush Short (0 delay)
	LINE	Thru with offset (a known delay)
LRL	LINE 1	Thru with offset 1 (a known delay)
	REFLECT	Flush Short (0 delay)
	LINE 2	Thru with offset 2 (a different known delay)

However, if SOLT is needed, offset load can be used in place of fixed load. Using offset load will result in a more accurate calibration than with broadband load, and below are the standards needed:

SOLT	Short	Flush Short
	Open	Flush Short and Offset
	Offset Load	Load with Offset 1 (a known delay)
		Load with Offset 2 (a different known delay)
	Thru	Thru (0 delay)

Select a standard by clicking on it, the example shows SHORT (Figure 30, left). This brings up the "Shorts" page. The key parameters to note are the frequency range, the delay value if applicable, and the value of Z0 (Figure 30, right). Click OK when done, and this returns to the "Add Standard" page. Repeat this step until all standards have been added. Figure 31 shows adding a THRU standard.

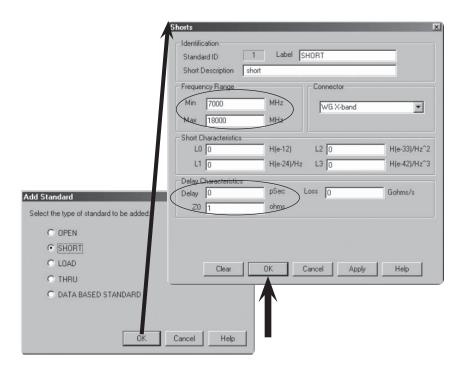



1	Thru/Line/Adapter
	Thru Description Insertable thru standard
	Frequency Range Min 7000 Max 18000
	Delay 0 pSec Loss 0 Gohms/s Z0 1 ohms 0
Add Standard	Connectors
Select the type of standard to be adde :	Port WG X-band Port WG X-band
C OPEN	
C SHORT	
C LOAD	Clear OK Cancel Apply Help
• THRU	Cancer Hoppy
C DATA BASED STANDARI	Cancel Help

Figure 31. Adding a THRU standard.

Once you have added at least one fixed load and two offsets of different length, you can then define an offset load. Figure 32 shows the "Loads" page, and the default of this page is "Fixed Load." When "Offset Load" is selected, the "Offset Load Definition" area becomes active and you must use the dropdown menu to select each standard element. The "Delay Characteristics" area then becomes inactive because this is applicable for "Fixed Load."

	Loads
	Identification Standard ID 5 Label [Offset LOAD]
	Load Description WG X-band load
	Frequency Range Connector Min 7000 MHz Max 18000 MHz
	Coad Type Arbitrary Complex Impedance ○ Fixed Load ○ Impedance Feal 50 ○ Sliding Load ○ Offset Load Imag 0
	Delay Characteristics Delay 0 pGec Loss 0 Gohms/s 20 1 ohms
	Offset Load Definition
Add Standard	First Offset Standard THRU
Select the type of standard to be added:	Second Offset Standard THRU 1/4 Offset
C OPEN	Load Standard LOAD
O SHORT	Clear OK Cancel Apply Help
C THRU C DATA BASED STANDARD	
OK	Cancel Help

Figure 32. Adding an Offset Load standard.

6. After all standards have been added, click **OK** on the "Add Standard" page to return to the "Edit Kit" page. All the standards that have been added should appear in the table (Figure 33, left). Now, under "Class Assignments", use the drop down menu to select "TRL" (or "SOLT") and then click on **Edit**. This brings up the "Class Assignments" page, Figure 33 (right) shows "Class Assignments" for TRL. For each "Class" selected, highlight the standard on the left, and then click on the ">>" button in the middle, to move the standard to the right under "Selected Standards."

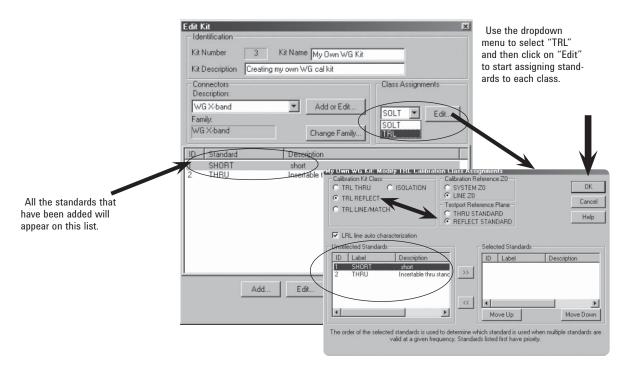


Figure 33. Assigning standards to class TRL.

Edit Kit		×		
Identification				
Kit Number 2	Kit Name My Own WG Kit			
Kit Description Creating n	nyown WG kit			
Connectors Description:		Class Assignments		
WG X-band	Add or Edit			
Family:		SOLT Edit		
WG X-band	Change Family			
ID Standard	Description	1		
1 SHORT	WG X-band short			
3 LOAD 5 Offset LOAD	WG X-band load WG X-band load	My Own WG Kit: Modify SOLT Calibratio	n Class Assignments	
2 THRU	Insertable thru standard	Calibration Kit Class		
4 THRU 1/4 Offset	Insertable thru standard	C S11A C S22A C FWD TR/		OK
			ICH O REV MATCH	Cancel
		● S11C ● S22C ● ISOLATIC	N	
		🔽 Link FWD TRANS, FWD MATCH, REV TR	ANS, and REV_MATCH	Help
		Expanded Calibration (applies to reflection cla	sses) Calibrati	on Class Label
,	1	Measure all mateable standards in class	S	11C LOAD
Add	Edit Delete	Use expanded math when possible		
	OK	Unselected Standards	Selected	d Standards
		ID Label Description		Label Description
		1 SHORT WG X-band sho		Offset LOAD WG X-band load
		2 THRU Insertable thru st 4 THBU 1/4 Offset Insertable thru st	andai 3	LOAD WG X-band load
		4 THIO I/4 OliseL Insertable (Ild si		
			<u> </u>	
		•		ove Up Move Down
		The order of the selected standards is used to	determine which standard	is used when multiple standards are
		valid at a given frequency. Standards listed fit		

Figure 34. Assigning standards to class SOLT (with Offset Load).

7. Click **OK** when done to return to the "Edit Kit" page, and then click **OK** again to return to the "Edit PNA Cal Kits" page. At this point, you should be able to see the kit that you just created under the list of "Installed Kits" (Figure 35).

ID Kit Name 1 85052B 2 85052D	Installed Kits Insert New Print to File Description 3.5 mm vith sliding load 3.5 mm Calibration Kit Kit Creating my own WG cal kit 3.5 mm Solt 7/TRL Calibration Kit 3.5 mm Solt 7/TRL Calibration Kit	
ID Kit Name 1 85052B 2 85052D 3 My Own W/G 4 85033D /E 5 85052C 6 85056A	Description 3.5 mm with sliding load 3.5 mm with sliding load 3.5 mm Calibration Kit Kit Creating my own WG cal kit 3.5 mm Calibration Kit	
1 850528 2 850520 3 My Own V/G 4 85033D/E 5 85052C 6 85056A	3.5 mm with sliding load 3.5 mm Calibration Kit Kit Creating my own WG cal kit 3.5 mm Calibration Kit	
2 85052D 3 My Own WG 4 85033D/E 5 85052C 6 85056A	3.5 mm Calibration Kit Kit Creating my own WG cal kit 3.5 mm Calibration Kit	
3 My Own WG 4 85033D/E 5 85052C 6 85056A	Kit Creating my own WG cal kit 3.5 mm Calibration Kit	
4 85033D/E 5 85052C 6 85056A	3.5 mm Calibration Kit	
5 85052C 6 85056A		
6 85056A	3.5 mm SOLT/TRL Calibration Kit	
6 85056A		
	2.4 mm with sliding load	
	2.4 mm Calibration Kit	
8 85056K	2.4 mm/2.92 mm with Broadband Load	
	85056K01 2.4 mm/2.92 mm with Sliding Load 85058B Databa. 1.85 mm Precision Database Cal Kit	
11 85058E Data 12 85058BP Pol		
	yno 1.85 mm (Reduced Accuracy) yno 1.85 mm Economy (Reduced Accuracy)	
14 85059A Data		
15 85059AP Pol		
16 85038A	7-16 Calibration Kit	
17 85050B	APC 7 with sliding load	
11 000000	Ai o r with aliding load	
	Edit Kit. Delete ^ v	

Figure 35. Calibration kit file created, done!

8. Congratulations! You are now ready to calibrate in waveguide.

Appendix B: Performing Calibrations

I. SmartCal, 2-port calibration

- 1. Calibration > Calibration Wizard ...
- 2. Select SmartCal (GUIDED Calibration), then click Next> (Figure 36, top)
- 3. Select *Cal Type*, click *Next*> (Figure 36, middle)
- 4. Use dropdown menu and then the scroll bar to select the DUT connectors (Figure 36, bottom). Also, use dropdown menu to select the available calibration kit based on the selected DUT connectors. Notice, the default *Cal Method* is *2-Port, Defined Thru*, TRL. Plus, if "Modify Cal" is not selected, then steps shown in Figure 37 will be skipped. Click *Next>*

Calibration Wizard: Begin Calibration Image: Calibration Wizard: Begin Calibration C [SmartCal (GUIDED Calibration): Use Mechanical Standards Select calibration preferences. C UNGUIDED Calibration (Response, 1-port): Use Mechanical Standards Select calibration preferences. C Use Electronic Calibration (ECal) Assistance is available in the online Help.
C UNGUIDED Calibration (Response, 1-port, 2-port). Use Mechanical Standards Select calibration preferences. Not sure about preferences? Assistance is available in the online
C Use Electronic Calibration (ECal) Not sure about preferences? Assistance is available in the online
Save Preferences. Don't show this page again
<brok next=""> Cancel Help</brok>
Select Guided Calibration Type (Mechanical Standards)
I per section I Port Cal Select 2nd Port: Select 2nd Port: Select 2nd Port:
< <u>Back</u> Next > Cancel Help
Use dropdown menu to select DUT connectors. DUT Port 1 VR-03 Waveguide V103_AL_03 V03_AL_03 V103_AL_03 V103_AU_03 V103_AU
Selecting "Modify Cal" will show steps in Figure 36.

Figure 36. Select SmartCal and DUT connectors.

5. Having selected "Modify Cal" allows you to change the *Cal Type*. Figure 37 (top) shows *Cal Type: TRL*, you can click *Mod Stds*, and then use the dropdown menu on the right to select a different cal type. Figure 37 (middle) shows the selection of *SOLT*. Clicking *OK* returns you to the previous screen, and this time it shows the *Cal Type: SOLT* (Figure 37, bottom).

ify Cal	
nru Calibration Options (Cal Type: TRL) Thru Cal Method	
Thru #1 1-2 🔽 Defined Thru 💌 Mod Stds	
Defned Thru Flush Thru Unknowm Thru Adapter Removal	
< <u>Back</u> <u>N</u> ext> Cancel Help	
View/Modify Properties of Cal for Ports 1 and 2	
Select 2-Port calibration type Advanced	
Defined Thru Calibration type TRL View/Modify IFIL Select View/Modify to preview the standards to be measured.	
OK Cancel Help	
Modify Cal Thru Calibration Option (Cal Type: SOLT) Thru Calibration Option (Cal Method: Thru #1 12 2 Defined Thru Mod Stds	×
	· ·
< Back Next> Cancel	Help

Figure 37. Changing Cal Type.

Mod

 The calibration has now begun. As shown on the upper-left corner of each screenshot (Figure 38), the 2-port, Flush Thru, TRL calibration includes four steps. The example shown here is based on using an OML cal kit.

Step 1 of 4: Port 1, Short Step 2 of 4: Port 2, Short Step 3 of 4: Port 1, THRU + NULL Shim, Port 2 Step 4 of 4: Port 1, THRU + ¼ Offset Shim, Port 2

Guided Calibration Step 1 of 4		×
PORT 1 SH	ORI	Measure
Connect G-BAND FLUSH SHOP	RT [S-05] to port 1	Done
Select [Measure] when connections have been made.		
	< Back Next >	Cancel Help
Guided Calibration Step 2 of 4		×
PORT 2 SH Connect G-BAND FLUSH SHOP		Measure Done
Select [Measure] when connections have been made.		
	< <u>B</u> ack <u>N</u> ext >	Cancel Help
Guided Calibration Step 3 of 4		X
PORT 1 THRU+NULL	SHIM PORT 2	[annumentation]
Connect G-BAND THRU [0S-05] NULL SH		Done
Select [Measure] when connections have been made.		
	< <u>B</u> ack <u>N</u> ext >	Cancel Help
Guided Calibration Step 4 of 4	5007.0	
PORT 1 THRU+1/4 OFFS	SET SHIM PORT 2	Measure
PORT 1 THRU+1/4 OFFS Connect G-BAND 1/4 OFFSET THRU [0S1/4-0 between port 1 and	15] 1/4 WAVE OFFSET NULL SHIM	Measure
Connect G-BAND 1/4 OFFSET THRU [0S1/4-0	15] 1/4 WAVE OFFSET NULL SHIM	<u></u>

Figure 38. Steps of the 2-port, Flush Thru, TRL calibration (using an OML cal kit).

7. Congratulations! You have just completed a 2-port, Flush Thru, TRL calibration.

Alternatives:

Using an OML calibration kit, performing an SOLT calibration with Offset Load would require 9 steps:

Step 1 of 9: Port 1, Short + NULL Shim Step 2 of 9: Port 1, Short + ¼ Offset Shim Step 3 of 9: Port 1, THRU + NULL Shim, Load Step 4 of 9: Port 1, THRU + ¼ Offset Shim, Load Step 5 of 9: Port 2, Short + NULL Shim Step 6 of 9: Port 2, Short + ¼ Offset Shim Step 7 of 9: Port 2, THRU + NULL Shim, Load Step 8 of 9: Port 2, THRU + ¼ Offset Shim, Load Step 9 of 9: Port 1, Port 2

Using an OML calibration kit, performing an SOLT calibration with fixed Load would require 7 steps:

Step 1 of 7: Port 1, Short + NULL Shim Step 2 of 7: Port 1, Short + ¼ Offset Shim Step 3 of 7: Port 1, Load Step 4 of 7: Port 2, Short + NULL Shim Step 5 of 7: Port 2, Short + ¼ Offset Shim Step 6 of 7: Port 2, Load Step 7 of 7: Port 1, Port 2

II. SmartCal, 1-port calibration

- 1. Calibration > Calibration Wizard ...
- 2. Select SmartCal (GUIDED Calibration), then click Next> (Figure 39, top)
- Select Cal Type. Notice on the right that you can choose either Port 1 or Port 2 as the test port for the 1-port calibration. Then, click Next> (Figure 39, middle)
- 4. Use dropdown menu and then the scroll bar to select the DUT connectors (Figure 39, bottom). Also, use dropdown menu to select the available calibration kit based on the selected DUT connectors. Notice, the *Cal Method* here is simply *1-Port*. Plus, if "Modify Cal" is not selected, then steps shown in Figure 40 will be skipped. Click *Next>*

Calibration Wizard: Begin Calibration 🔀
C UNGUIDED Calibration (Response, 1-port, 2-port): Use Mechanical Standards Select calibration preferences.
C Use Electronic Calibration (ECal) Not sure about preferences? Assistance is available in the online Helo.
Save Preferences. Don't show this page again.
Kenton Cancel Help
Select Guided Calibration Type (Mechanical Standards)
Cal Type Selection
< <u>Back</u> <u>Next</u> > Cancel Hep
Use dropdown menu to select DUT connectors.
show steps in Figure 39." OFFIONAL Select [MGdfy Cal] to change the Cal Method and/or standards used for the selected cal kits.

Figure 39. Select SmartCal and DUT connectors.

£

5. Having selected "Modify Cal" allows you to look at the screens shown in Figure 40. However, in the case of 1-port calibrations, you are limited to SOL calibration only. Thus, clicking on "Modify Cal" does not offer you additional selection. Your *Cal Type* remains as *One Port*.

Iodify Cal Thru Calbratigr Options (Cal Type: 1-Port) Thru Cal Method Port 1 2 One Port 2 Mod Stds	×
	<u>, 1997 - 1997 - 1997 - 1997 - 1997 - 1997 - 1997 - 1997 - 1997 - 1997 - 1997 - 1997 - 1997 - 1997 - 1997 - 199</u> 1997 - 1
	< Back Next> Cancel Help
View/Modify Selections of Cal Standa	rds for this Cal
- Select 1-Port calibration type	Advanced
One Port	Calibration type
	Select View/Modify to preview the standards to be measured.

Figure 40. Viewing Modify Cal displays.

6. The calibration has now begun. As shown on the upper-left corner of each screenshot (Figure 41), the 1-port calibration includes three steps. The example shown here is based on using a OML cal kit.

Step 1 of 3: Port 1, Short + Null Shim Step 2 of 3: Port 1, Short + ¼ Offset Shim Step 3 of 3: Port 1, Load

Guided Calibration Step 1 of 3 PORT 2	×
PORT 1 SHORT+NULL SHIM	Measure
Connect G-BAND_SHORT [S-05 +0S-05] SHORT + 0.100" NULL SHIM to port 1	Done
Select [Measure] when connections have been made.	
< Back Next >	Cancel Help
Guided Calibration Step 2 of 3	x
PORT 1 SHORT+1/4 OFFSET SHIM	Measure
Connect G-BAND 1/4 OFFSET SHORT [S-05+ 0S1/4:05] SHORT+ 1/4 WAVE NULL OFFSET SHIM to port 1	Done
Select [Measure] when connections have been made.	
< <u>B</u> ack <u>N</u> ext >	Cancel Help
Guided Calibration Step 3 of 3	×
PORT 1 LOAD	Measure
Connect G-BAND FLUSH FIXED LOAD [T-05] to port 1	Done
Select [Measure] when connections have been made.	
< <u>₿</u> ack <u>N</u> ext>	Cancel Help

Figure 41. Steps of the 1-port calibration.

7. Congratulations! You have just completed a 1-port calibration.

Alternative:

Using an OML calibration kit to perform a 1-port SOL calibration with Offset Load would require 4 steps:

Step 1 of 4: Port 1, Short + NULL Shim Step 2 of 4: Port 1, Short + ¼ Offset Shim Step 3 of 4: Port 1, THRU + NULL Shim, Load Step 4 of 4: Port 1, THRU + ¼ Offset Shim, Load

III. Unguided Calibration, Thru Response

- Calibration > Calibration Wizard ...
 Select UNGUIDED Calibration, then click Next> (Figure 42, top)
- 3. For Unguided calibration, the user must select the calibration kit because the default (or the kit last used) is often not what you want. Click on *View/Select Cal Kit* (Figure 42, middle) and then use the scroll bar to select the calibration kit of choice (Figure 42, bottom). Click **OK**.

Calibration Wizard: Begin Calibration	
O SmartCal (GUIDED Calibration): Use Mechanical Standards	
UNGUIDED Calibration (Response, 1-port, 2-port): Use Mechanics	al Standards Select calibration preferences.
C Use Electronic Calibration (ECal)	Not sure about preferences? Assistance is available in the online Help.
	Save Preferences. Don't show this page again.
	Back Next> Cancel Help
2 Port Solt T Port Solt TFIL Response	Configuration Selected Cal Kit: 850368/E TypeN (75) Calibration Kit Characterization: < (type> View/Select Cal Kit < <u>Kit</u> < <u>Kit</u> Cancel Help
Choose class type Choose class	ID Kit Name Description A Description A Description A Description A Description A Description Solution Solut

Figure 42. Select Unguided calibration, and calibration kit of choice.

4. This returns to the previous page, and the Cal Kit information has been updated (Figure 43, top). Make sure Response is highlighted on the left. (If not, click on it once.) Click Next> to start the Response calibration.

Sele

Your Response calibration selection will be different depending on your active trace. If the active trace is S11, then you will see the standard selection for Reflection Response, as those shown in Figure 43 middle. If the active trace is S21, then the standard selection are those for Transmission Response, as those shown in Figure 43 bottom.

Select Calibration Type f	for Mechanical Sta	ndards				×	
Cal Type Selection 2 Port Solt 1 Port Solt TRL Response	Response	Configuration	OML WR-0 Characteriz	al Kit: V03_A 3 (J Band) Un ation: < type View/Select I	iversal Calibration		
		< <u>B</u> ack	. <u>N</u> ext :	, C.	ancel H	elp	
Mea	asure Mechanical	Standards					
-	Port 1 (S11)						Show Prompts
	1 0/1 (011)						
	Short Short Offset	l ;				N	ormalize
	Cal Kit 34: V03_AL_03	OML WR-03 (J Band) U	Iniversal				
Re	eflection Response: Se	lect a standard					
						<u> </u>	
			Γ	< <u>B</u> ack	Next >	Cancel	Help
	asure Mechanical S						
Met	asure mechanical :	standards					Show Prompts
E.	Port 2 - Port 1 (S21)-						onow Frompts
1	Thru				Isolation	N	ormalize
1					_(optional)_		Jimaiize
	Cal Kit 34- V03_AL_03	OML WB-03 (J Band) U	Iniversal				
	ansmission Response:						
			[< <u>B</u> ack	Next >	Cancel	Help
					10,000,000		

Figure 43. Response calibration and associated standard selection for Reflection Response and Transmission Response.

5. Congratulations! You have just completed a Response calibration.

Appendix C: Caring For Waveguide (WG) Interfaces A clean surface at millimeter-wave is much more important than at lower frequencies because any debris on its surface can potentially be added to the measurement distorting the measurement results.

Caring for WG interfaces is not difficult. Dirt and dust can be removed using the following items:

- Isopropyl Alcohol 99.5%
- Lint-free cloth
- Pressurized air for dust removal

To remove dirt on the surface, simply put a few drops of the Isopropyl Alcohol on the Lint-free cloth and then gently wipe the surface.


To remove dust, simply spray the pressurized air on the surface.

Appendix D: Supplemental Data

As can be seen in Figures 17 through 20, using external synthesizers for higher frequency ranges, such as 140 to 220 GHz (WR-05) and 220 to 325 GHz (WR-03), can improve dynamic range up to 10 dB and 20 dB, respectively, as well as improving trace noise. Below, figures 44 through 46 show that the PSG series used as external synthesizers do not make any difference with or without Option UNX, ultra-low (close-in) phase noise. We chose to focus our comparison in the frequency range of 220 to 325 GHz only because if there is any noticeable difference, it would easily appear at this frequency range than at a lower one. In the comparison, either both PSG units have Option UNX, or they both do not.

In the case of trace noise, both transmission (S21) and reflection (S11) have remained very low regardless of Option UNX. They are less than ±0.0300 dB in the worst case; above 290 GHz in the case of S21, and above 305 GHz in the case of S11.

Based on these measurement results, we are no longer including Option UNX on the PSG configurations when used as external synthesizers.

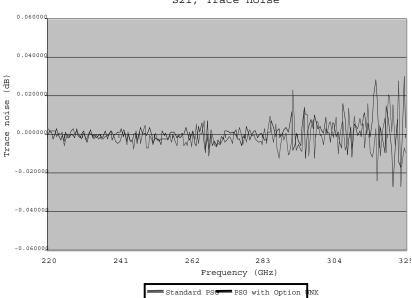

S21, Trace noise

Figure 44. S21 trace noise comparison between measurements made with external synthesizers with and without Option UNX, ultra-low (close-in) phase noise.

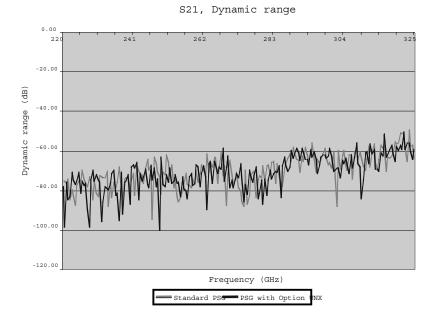


Figure 45. S21 dynamic range comparison between measurements made with external synthesizers with and without Option UNX, ultra-low (close-in) phase noise.

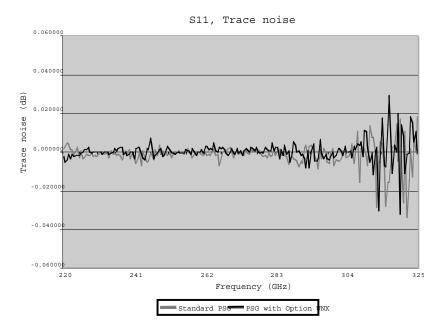


Figure 46. S11 trace noise comparison between measurements made with external synthesizers with and without Option UNX, ultra-low (close-in) phase noise.

Web Resources

For additional literature and the latest product information, visit our Web sites:

PNA Series Network Analyzers www.agilent.com/find/pna

Antenna measurements www.agilent.com/find/antenna

PSG Signal Generators www.agilent.com/find/psg

Test and measurement accessories www.agilent.com/find/accessories

Agilent Email Updates

www.agilent.com/find/emailupdates Get the latest information on the products and applications you select.



www.lxistandard.org

LXI is the LAN-based successor to GPIB, providing faster, more efficient connectivity. Agilent is a founding member of the LXI consortium.

Agilent Channel Partners

www.agilent.com/find/channelpartners

Get the best of both worlds: Agilent's measurement expertise and product breadth, combined with channel partner convenience.

Remove all doubt

Our repair and calibration services will get your equipment back to you, performing like new, when promised. You will get full value out of your Agilent equipment throughout its lifetime. Your equipment will be serviced by Agilent-trained technicians using the latest factory calibration procedures, automated repair diagnostics and genuine parts. You will always have the utmost confidence in your measurements. For information regarding self maintenance of this product, please contact your Agilent office.

Agilent offers a wide range of additional expert test and measurement services for your equipment, including initial start-up assistance, onsite education and training, as well as design, system integration, and project management.

For more information on repair and calibration services, go to:

www.agilent.com/find/removealldoubt

www.agilent.com www.aqilent.com/find/mmwave

For more information on Agilent Technologies' products, applications or services, please contact your local Agilent office. The complete list is available at:

www.agilent.com/find/contactus

Americas

Canada	(877) 894 4414
Latin America	305 269 7500
United States	(800) 829 4444

Asia Pacific

Australia	1 800 629 485
China	800 810 0189
Hong Kong	800 938 693
India	1 800 112 929
Japan	0120 (421) 345
Korea	080 769 0800
Malaysia	1 800 888 848
Singapore	1 800 375 8100
Taiwan	0800 047 866
Thailand	1 800 226 008

Europe & Middle East

Europo a milaulo E		
Austria	43 (0) 1 360 277 1571	
Belgium	32 (0) 2 404 93 40	
Denmark	45 70 13 15 15	
Finland	358 (0) 10 855 2100	
France	0825 010 700*	
	*0.125 €/minute	
Germany	49 (0) 7031 464 6333	
Ireland	1890 924 204	
Israel	972-3-9288-504/544	
Italy	39 02 92 60 8484	
Netherlands	31 (0) 20 547 2111	
Spain	34 (91) 631 3300	
Sweden	0200-88 22 55	
Switzerland	0800 80 53 53	
United Kingdom	44 (0) 118 9276201	
Other European Countries:		
www.agilent.com/find/contactus		
Revised: October 1, 2009		

Product specifications and descriptions in this document subject to change without notice.

© Agilent Technologies, Inc. 2009 Printed in USA, November 24, 2009 5989-4098EN

